Service Information Letter

RotorSport UK Ltd Poplar Farm, Prolley Moor, Wentnor, Bishops Castle, Shropshire,UK, SY9 5EJ SILNo.: 004 issue 1, dated 08.04.2010 Aircraft type & model (applicability) RotorSport MT-series CCAR No.: None Aircraft serial Nos. effected MT-03/all, MTOsport/all

The purpose of this document is to communicate information to pilot owners of RotorSport aircraft that may be of benefit. If there is any clarification required of the content of the letter, contact RSUK on 44(0)1588 650769, or email info@rotorsport.org.

Subject

When working on the aircraft with the instrument panel removed/disconnected the earthing arrangement for the magnetos is non-functional. This could, in theory, enable the engine to kick (or even run) if turned-over by rotation of the propeller. It is recommended that while the instrument panel is removed/disconnected Safety Plug RSD7191 is fitted to prevent this possibility. The plugs are available from RotorSport UK Ltd

Safety effect

Improved during maintenance, no effect in flight

Issue date: 08.04.2010

Weight and CG effect

None

To fit the safety plug

The "magneto" earth cables are connected to the rear of the instrument panel by means of a purple connector. If not already disconnected press the release lever and pull apart the connector halves. Push the male end of the safety plug into the female half of the aircraft wiring loom until it latches in place. Fit the crocodile clip on to the aircraft's earth stud (located on the keel behind the instrument panel). The two leads from the magnetos (ignition modules) of the engine are now earthed. This provides the same effect as selecting "Mags off".



Safety plug RSD7191

Plug in place and earthed by crocodile clip

To remove the safety plug

Remove the crocodile clip. Press the release lever and pull apart the purple connector.

Reinstate the two halves of the purple connector to complete the aircraft's wiring during refit of the instrument panel. Ensure that the connector barb locks in place.

Service Information Letter

		Re	otorSpoi	rt UK Ltd	
]	Poplar Farm, P	rolley Moor	, Wentnor, Bi	ishops Castle, Shrops	shire,UK, SY9 5EJ
SILNo.: 004 issue 1, dated 08.04.2010				CCAR No.: None	
Aircraft type & model (applicability)				Aircraft serial Nos. effected	
RotorSport MT-series				MT-03/all, MTOsport/all	
				•	
Effect on Pilots Ha	ndbook or Mai	intenance M	anual?		
Yes, comments to b	pe incorporated	l at next issu	e of Maintena	ance Manual.	
SIL authorised by:	(name, signatu	re. and date	of signature)		
SIL authorised by: (name, signature, and date of signature) Quality Conformance Engineering Chief Test Pilot (i				if flight performance	Structures (where required)
Manager Manager			or safety effect)		Structured There required)
14/4		6/4/10	Tollater ?	\$	15/04/2010
Document	Issued to:	When	Issuer name		Signature
completion date:	Internal				
	CAA				
	Owners				